Instructions for Use

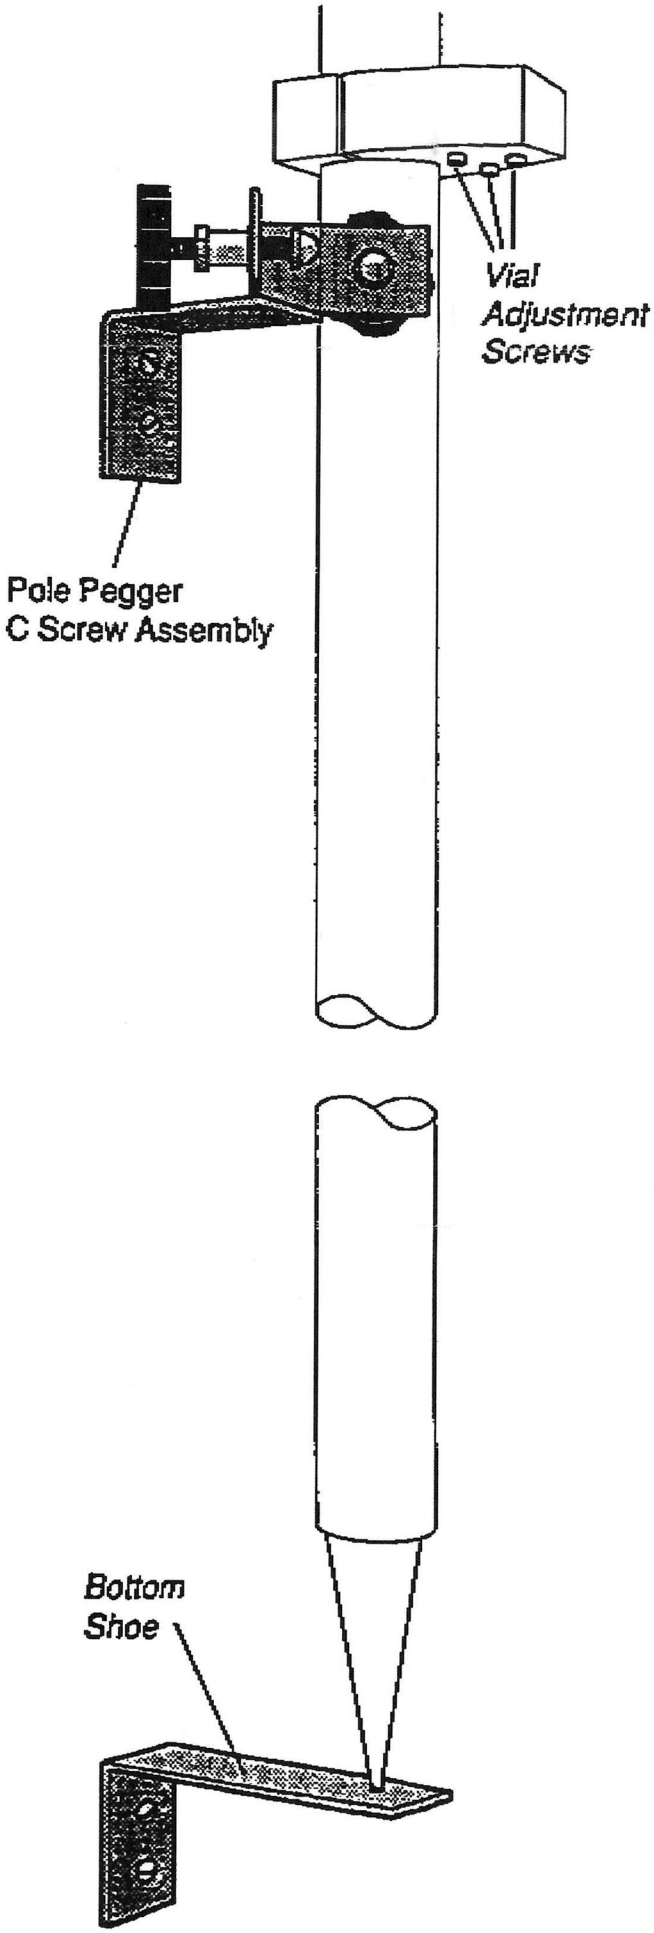

Step 1. Mount to a wall in your office.

Step 2. Place prism pole tip in bottom shoe. Lean pole against C screw assembly. Now turn C screws in direction needed to center bubble in bulls eye.

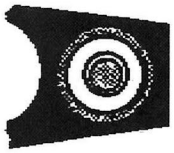

Step 3. Now rotate or spin prism pole 180°. Bubble will show amount of error.

Step 4. Adjust C screws until bubble moves half way back towards center.

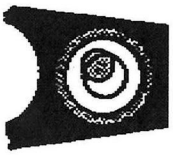

Step 5. Adjust vial adjustment screws until bubble is centered.

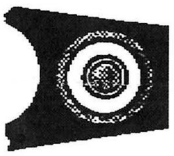

Repeat Steps 2 thru 5 at least twice, or until bubble remains centered in a full 360° rotation.